

TTSH Release rev.4

the TTSH v4 is the same Version like TTSH rev.3 - but with bugfixes.


The TTSH v4 is only available by synthcube - Kits, Fullkits, cases - mostly everything you want.

<https://synthcube.com/cart/ttsh-v4>

If you're looking for an assembled TTSH or you want a modification, build, repair - Service- [contact me](#)

Known Issues:

the Pinout problem of the Dual JFET 2N3954 in the VCO2 section (mainboard) is still available.

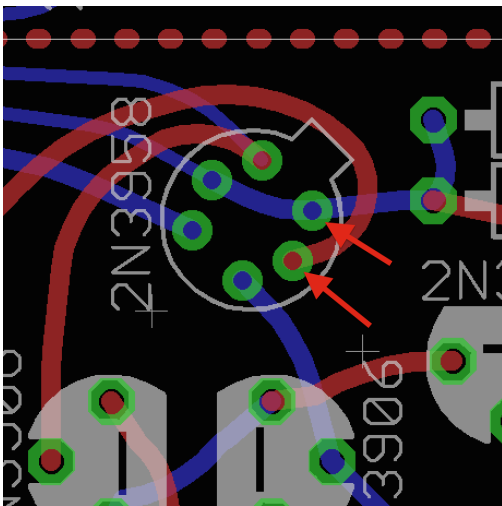


Frontpanel - all holes must be enhanced by drilling. all slider cutouts must be reworked with a file 🙄

that's not an issue, that's a problem for some users.

Synthcube was informed but still send this panels to customers.

In the Fullkits are many slider pins bend or the lever is broken or bend - you need replacements.

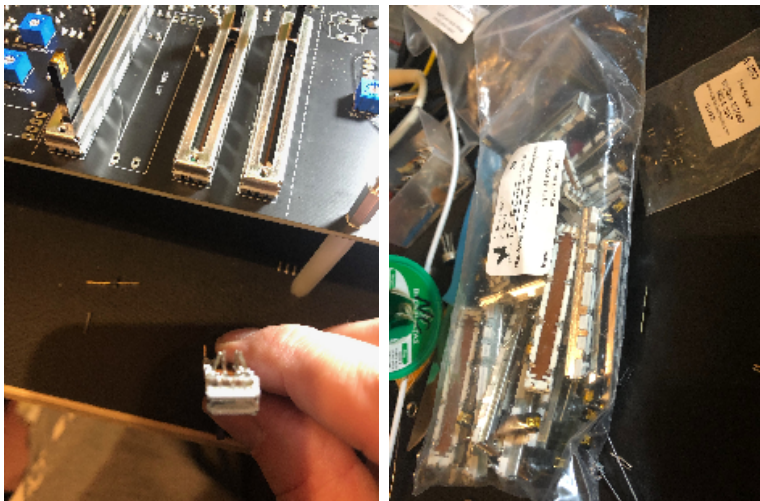

Build Guide from Antony "Fuzzbass" v1.7 (update 29.dec.2019)

https://drive.google.com/file/d/15LcVl6dmxVoriJ3EP7WcftJFTHrW5Kw-/view?fbclid=IwAR2Egjr7iOgwGv5dcD7pHh6iBK_N2jCJF5T_Xk8CpElvJ6oDoFBHxHXsSns

added Midi Interface guide in v1.7

failure in previous guide: (1.2) corrected in 1.3 guide and newer

there's a failure with the 4012 VCF card, the capacitors between the matched 2N3904 must be 4x 0,01uF (10nF) C0G or polypropylene caps - better to organise 1% Polyprop caps, you can mount it from the rearside too.